
CITY OF BALTIMORE WET W SMOKE AND DYED W	Page 1 of 5	
Sewershed: JONES FALLS	Company: REI/DRAYCO	Date: 07/08/08
Test to be Performed: SMOKE	Ground Condition: DRY	Supervisor: ER
Manhole ID: S39OO_014MH	Test ID: 0994-357	Notifications Made:_X (Residents, Fire, 311)

Field Sketch: (Show All Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)

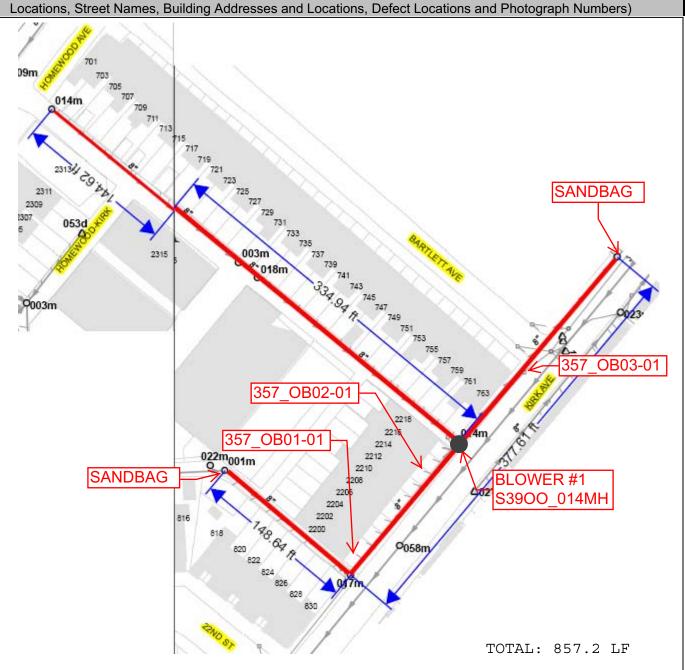

CITY OF BALTIMORE WET WEATH SMOKE AND DYED WATER						Page 2 of 5			
Sewershed: JONES FALLS			Company: REI/DRAYCO			Date: 07/08/2008			
Test to	be Performed:			Ground	Condition	:		Supervis	or:E.R
Smoke:X Dyed Water:		Dry: _X Damp: Wet:			/et:	Cuper visor:E.r			
				BryX Bamp wet			Notification	ns Made: X	
Manhole ID: S39OO_014MH		Test ID: 0994-357			(Residents, Fire, 311)				
	Sketch: (Showons, Street Nam							_	
Defect				Source			Drainage		ŕ
No.		Address		Туре	Location	Sector	Area	Severity	Photo Number
1	2200 KIRK AVE	<u> </u>		03	07	02	3	03	357_OB01-01
2	2214 KIRK AVE			03	07	02	0	03	357 OB02-01
3	763BARTLET			11	02	01	2000	03	357 OB03-01
3	163DANILEI	l .		11	02	01	2000	03	337_0003-01
				OBSERV	<u>/ATION</u>	CODES			
	Source Type	Location	Sector	Severity		Source Type	Location		
01	Main Sewer	Paved Concrete	Public	No Smoke	10	MH Frame S	Non-Paved		
02	Service Line	Paved Asphalt	Private	Trace	11	Storm Drain	Field/Woods		
03	Cleanout	Paved Other		Moderate		Catch Basin/			
04	Downspout	Driveway		Major	13	Storm Manh	Golf Course		
05	Area Drain	Sidewalk			14	Storm Ditch	Other		
06	Driveway Drain	Curb			15	Excavation			
07	Stairwell Drain	Yard- Front			16	Other			
08	Foundation Drain	Yard-Back							
09	Building Interior	Yard- Side							

PAGE 3 OF 5

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 357	Date: 07/08/2008	Basin: JF-19
Defect No: OB01	Supervisor: E.R.	Dye Test Recommended: N
House No: 2200	Street Name: KIRK	Street Type: AVE.
Source Type: 03	Location: 07	Severity: 03
Sector: 02	Drainage Area: 3	

Comments: CLEAN OUT - AT GRADE - BROKEN CAP

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01 Filename: 0994-357_OB01-01.jpg

PAGE 4 OF 5

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 357	Date: 07/08/2008	Basin: JF-19
Defect No: OB02	Supervisor: E.R.	Dye Test Recommended: N
House No: 2214	Street Name: KIRK	Street Type: AVE.
Source Type: 03	Location: 07	Severity: 02
Sector: 02	Drainage Area: 3	

Comments: CLEAN OUT - ABOVE GRADE - BROKEN CAP

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01 Filename: 0994-357_OB02-01.jpg

PAGE 5 OF 5

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 357	Date: 07/08/2008	Basin: JF-19
Defect No: OB03	Supervisor: E.R.	Dye Test Recommended: N
House No: 783	Street Name: BARTLETT	Street Type: AVE.
Source Type: 11	Location: 02	Severity: 03
Sector: 01	Drainage Area: 2000	

Comments: SMOKE COMING OUT OF STORM DRAIN AT KIRK AVE. & BARTLETT AVE.

SMOKE TEST PHOTOGRAPHS



Photograph No: OB03-01 Filename: 0994-357_OB03-01.jpg